

**WEATHERING QUALITY OF COARSE AGGREGATE
TEST REPORT**




Project : Production Test
 Location : Taupo Scoria
 Client : Taupo Scoria Ltd
 Contractor : Taupo Scoria Ltd
 Sampled by : WSP Taupo Laboratory
 Date sampled : 9/09/26
 Sampling method : NZS 4407:2015.2.4.6.3.2
 Sample description : AP40
 Sample condition : Moist
 Source : Taupo Scoria

Project No :
 Lab Ref No : TP57
 Client Ref No :

Test Results

Percentage Retained on 4.75mm BS Sieve After 10 Cycles : 97
 Cleanness Value After 10 Cycles : 95
 Weathering Quality Index (see table below) : AA

Cleanness Value	Percentage Retained on 4.75mm Sieve			Specified
	96 - 100	91 - 95	up to 90	
91 - 100	AA	BA	CA	TNZ M/4 2024 AA, AB, AC BA, BB, CA
71 - 90	AB	BB	CB	
up to 70	AC	BC	CC	

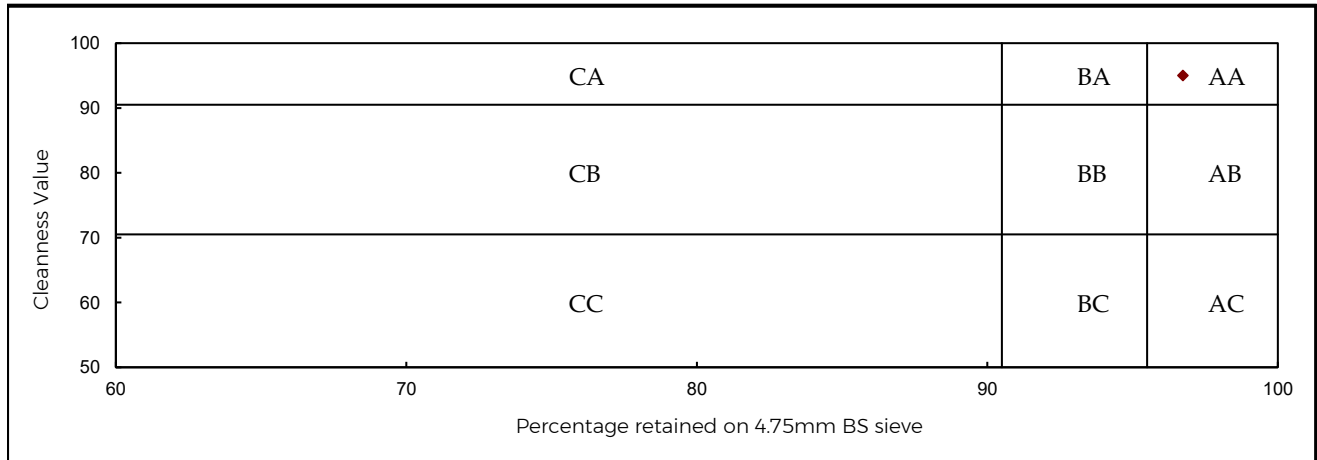

Test Method	Notes
Weathering Quality Index, NZS 4407:2015, Test 3.11	♦ Is graphed value of Weathering Quality Index. Specification taken from NZTA M/04 Class 3 AP40 All information supplied by Client

Date tested : 22/09/26
 Date reported : 29/09/26

Sampling is covered by IANZ Accreditation
 This report may only be reproduced in full

Approved Signatory

Designation : Assistant Laboratory Manager
 Date : 29/09/26



All tests reported herein
 have been performed in
 accordance with the
 laboratory's scope of
 accreditation